



## DATA SHEET

# KISTOCK DATALOGGER KT220 / KH 220 / KTT 220

**Temperature / Humidity / Light / Current  
Voltage / Impulsion / Water pressure**



## Features

- Software for configuration and data visualisation freely downloadable
- Software for configuration and data processing available as option
- Storage capacity of 1,000,000 points
- Fast data downloading (18,000 points/s)
- Up to 5 recordable parameters simultaneously
- 2 configurable setpoint alarms for each channel
- 2 lines LCD screen
- F Magnetic mounting

## References

Reference	Display	Internal sensor	External sensor	Parameters
KT 220-O	Yes	1: Temperature	1 input for universal probe <sup>(1)</sup>	Temperature, humidity, current, voltage, impulsion, water pressure
KH 220-O	Yes	3: Temperature, humidity & light	1 input for universal probe <sup>(1)</sup>	Temperature, humidity, current, voltage, impulsion, water pressure, light
KTT 220-O	Yes	N/A	2 inputs for thermocouple probes <sup>(2)</sup>	Temperature



For a fast measurement of temperature and humidity variations, it is better to use a remote probe (KTHA or KTHD probe, see page 3).

## General features

Display	2 lines LCD screen. Dimensions: 39 x 34 mm / 1 <sup>34</sup> / <sub>64</sub> " x 1 <sup>22</sup> / <sub>64</sub> " . 2 indication LEDs (red and green)
PC communication	1 micro-USB input
Power supply	1x AA lithium 3.6 V battery
Protection	KT 220: IP65. KH 220 : IP20. KTT 220 <sup>(3)</sup> : IP54
Material	Compatible with food industry environment. ABS housing
Dimensions	KT220, KH220: 96 x 65.2 x 30.5 mm / 3 <sup>50</sup> / <sub>64</sub> " x 2 <sup>36</sup> / <sub>64</sub> " x 1 <sup>13</sup> / <sub>64</sub> " KTT220: 93.2 x 65.2 x 30.5 mm / 3 <sup>43</sup> / <sub>64</sub> " x 2 <sup>36</sup> / <sub>64</sub> " x 1 <sup>13</sup> / <sub>64</sub> "
Weight (with battery)	115 g / 4 oz
Environmental conditions of use	Air and neutral gases. Hygrometry: in non condensing condition. Maximum altitude: 2000 m / 2188 yd.
Warranty	1 year

<sup>(1)</sup> Input which allows to plug different compatible probes, see the optional probes and cables page 3.

<sup>(2)</sup> For more details about the available thermocouple probes, please see the "Thermocouple probes" datasheet.

<sup>(3)</sup> With all the thermocouple probes connected.

## Technical specifications

	KT 220	KH 220	KTT 220
Units displayed	°C, °F, °Ctd, °Ftd, %RH, mV, V, mA, A, bar <sup>(1)</sup>	°C, °F, °Ctd, °Ftd, %RH, lux, fc, mV, V, mA, A, bar <sup>(1)</sup>	°C, °F
Resolution	0.1 °C, 0.1 °F, 0.1 %RH, 1 mV, 0.001 V, 0.001 mA, 0.1 A, 0.1 bar	0.1 °C, 0.1 °F, 0.1 %RH, 1 lux, 0.1 fc, 1 mV, 0.001 V, 0.001 mA, 0.1 A, 0.1 bar	0.1 °C, 0.1 °F
External input	Female micro-USB connector		
Input for probe	1 universal input <sup>(2)</sup>		2 inputs for thermocouple probes (K, J, T, N, S)
Internal sensor	Temperature	Temperature, humidity, light	-
Type of sensor	NTC	Temperature: NTC. Humidity: capacitive. Light: photodiode.	Thermocouple
Measuring range	Measuring range of the internal sensor <sup>(3)</sup> : From -40 to +70 °C / -40 to 158 °F	Measuring range of the internal sensor <sup>(3)</sup> : Temperature: from -20 to +70 °C / -4 to 158 °F Humidity: from 0 to 100 %RH Light: from 0 to +10,000 lux / 0 to 929 fc	K: From -200 to +1300 °C / -328 to 2372 °F J: From -100 to +750 °C / -148 to 1382 °F T: From -200 to +400 °C / -328 to 752 °F N: From -200 to +1300 °C / -328 to 2372 °F S: From 0 to 1760 °C / 32 to 3200 °F
Accuracies <sup>(4)</sup>	±0.4 °C from -20 to 70 °C ±0.8 °F from -4 to 158 °F  ±0.8 °C below -20 °C ±1.5 °F below -4 °F	Temperature: ±0.4 °C from 0 to 50 °C ±0.8 °F from 32 to 122 °F ±0.8 °C below 0 °C or above 50 °C ±1.5 °F below 32 °F or above 122 °F Humidity <sup>(5)</sup> : ±2 %RH from 5 to 95 %RH from 15 to 25 °C / from 59 to 77 °F Light: ±10% of reading +10 lux / +1 fc	K, J, T, N: ±0.4 °C from 0 to 1300 °C ±0.8 °F from 32 to 2372 °F ±(0.3% of reading +0.4 °C) below 0 °C ±(0.3% of the reading +0.8 °F) below 32 °F  S: ±0.6 °C / ±1.1 °F
Setpoints alarm	2 setpoint alarms on each channel		
Frequency of measurement	From 1 second to 24 hours		
Operating temperature <sup>(6)</sup>	From -40 to +70 °C / -40 to 158 °F	From -20 to +70 °C / -4 to 158 °F	From -20 to +70 °C / -4 to 158 °F
Storage temperature	From -20 to +50 °C / -4 to 122 °F		
Battery life	4 years <sup>(7)</sup>		
Directives	2011/65/EU RoHS II; 2012/19/EU WEEE; 2014/30/EU EMC; 2014/35/UE; FCC part 15; UL 61010		

<sup>(1)</sup> Some units are available only with optional probes.

<sup>(2)</sup> Input which allows to plug different compatible probes: see optional probes and cables page 3.

<sup>(3)</sup> Other measuring ranges are available according to the connected probe: see optional probes and cables page 3.


<sup>(4)</sup> All accuracies indicated in this document were stated in laboratory conditions and can be guaranteed for measurement carried out in the same conditions, or carried out with calibration compensation.

<sup>(5)</sup> Factory calibration uncertainty: ±0.88 %RH. Temperature dependence: ±0.04 x (T-20) %RH (if T<15°C or T>25 °C) / ±0.04 x [(T °F -32) x 5/9] -20] % RH (if T≤59 °F or T≥77 °F).


<sup>(6)</sup> The screen can be hard to read, and its display speed often slows down at temperatures lower than 0 °C / 32 °F. This has no effect on the accuracy of measurements.

<sup>(7)</sup> Non-contractual value. Based on 1 measurement each 15 minutes at 25 °C / 77 °F. A correct operation of the device and the storage conditions must be respected.

## Dimensions

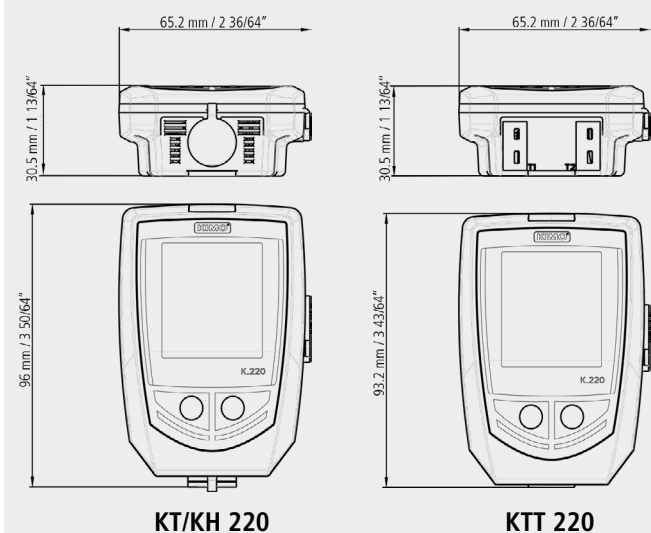

## Dimensions of the safety lock wall mount

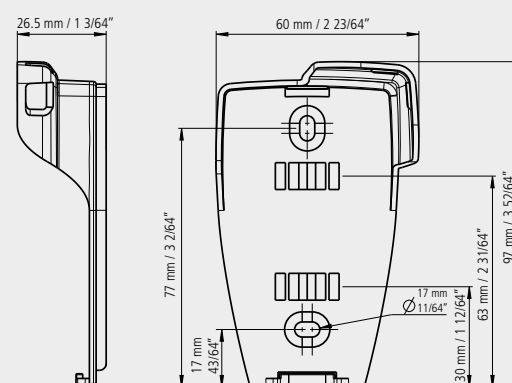

## Connections



**KT/KH 220**

- 1 - Micro-USB connector
- 2 - Input for universal probe



**KTT 220**

- 1 - Micro-USB connector
- 2 - 2 thermocouple inputs

## Optional probes and cable

References	Description	Measuring ranges
<b>Temperature and humidity probe</b>		
KTHA	Interchangeable hygrometry and ambient temperature probe	Hygrometry: from 0 to 100 %RH
KTHD	Remote interchangeable hygrometry and temperature probe	Temperature: from -20 to +70 °C / -4 to 158 °F
<b>NTC Temperature probe</b>		
KSI-50 / KSI-150	IP65 immersion probe	From -40 to +120 °C / -40 to 248 °F
KSA-150	Ambient use probe	From -40 to +120 °C / -40 to 248 °F
KSF-2	Wire probe	From -20 to +100 °C / -4 to 212 °F
KSPP-150	IP68 penetration probe	From -40 to +120 °C / -40 to 248 °F
KSP-150	IP65 penetration probe	From -40 to +120 °C / -40 to 248 °F
KCV-220	Probe with velcro	From -20 to +90 °C / -4 to 194 °F
<b>Current and voltage input cables and pulse input cable</b>		
KCTD-10-B	Voltage input cable	0-5 V or 0-10 V
KCCD-02-B	Current input cable	0-20 mA or 4-20 mA
KCTD-I-B	Pulse input cable	Maximal voltage: 5 V Type of input: TTL frequency counting Maximal frequency: 10 kHz Maximum number of recordable points: 20,000 points
<b>Ammeter clamps</b>		
KPID-50-BRF	Ammeter clamp from 0 to 50 A, frequency range from 40 to 5000 Hz	From 0 to 50 AAC
KPID-100-BRF	Ammeter clamp from 0 to 100 A, frequency range from 40 to 5000 Hz	From 1 to 100 AAC
KPID-200-BRF	Ammeter clamp from 0 to 200 A, frequency range from 40 to 5000 Hz	From 1 to 200 AAC
KPID-600-BRF	Ammeter clamp from 0 to 600 A, frequency range from 40 to 5000 Hz	From 1 to 600 AAC
<b>Relative pressure probe (water probe)</b>		
KSPE-2	Relative pressure probe for liquids and gases (corrosive)	From 0 to 20 bars / 0 to 290 PSI
<b>Thermocouple probes</b>		
For more details about the available thermocouple probes, please see the "Thermocouple probes" datasheet.		

## Recorder function

### Five recording modes

KISTOCK can record in 5 different ways:

- **"Immediate"** mode records values according to a predefined interval.
- **"Minimum", "Maximum" and "Average"** record automatically the calculation of minimum, maximum or average of measured values during an interval of recording.
  - **"Monitoring"** mode allows to get an accurate history report during error events to help troubleshooting, without stopping the measurement logging. To proceed this way, you just have to define :
    - a record interval to be used whilst the readings are beyond the setpoints
    - a record interval for the values measured during each reading beyond the setpoints
- Furthermore, you can also let your KISTOCK record non-stop ("**loop**" recording option).

### Four types of dataset start

Once your recording mode has been set, you can launch your dataset:


- With a delayed start (with predefined date and time)
- With the software
- With push-button
- With **"Online"** option. In this case, your datasets are directly sent, saved and displayed on your PC in real time.

### Six types of dataset stop

You can stop your dataset:

- According to a date and time (if it was started the same way)
- According to a period
- According to a predefined number of recording points
- Once the storage capacity is full
- With **"Stop"** option of the software
- By holding **"OK"** key during 5 seconds, if this function has been previously activated by the software

## Display

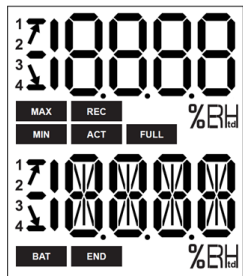

**END** DATASET is finished.

**REC** Indicates that one value is being recorded.  
It flashes: the DATASET did not start already.

**FULL** Flashing slowly: DATASET is between 80 and 90% of the storage capacity.  
Flashing quickly: DATASET is between 90 and 100% of the storage capacity.  
Constant: storage capacity full.

**BAT** Constant: indicates that the batteries have to be replaced.

**1 2** Indicates the channel number  
**3 4** which is measuring.

**ACT** Screen actualisation of measured values.

**MIN** The displayed values are the maximum/minimum values recorded for the channels displayed.

**MAX** Indication of the direction of exceeding the threshold in the recorded measurement

°C: Temperature in °Celsius.

°F: Temperature in °Fahrenheit

%RH: Relative humidity (KH 220)

## Mounting

The KT 220, KH 220 and KTT 220 KISTOCK have a magnetic mounting, so you can fix it easily.

## Replace the battery



With 4 years\* of battery life, the KISTOCK devices guarantee long-term measurements.

To replace the battery:

- Unscrew the 4 screws on the back side of the device with a screwdriver.
- Remove the back side and the old batteries.
- Insert the new battery and respect the polarity.
- Replace the back side and the 4 screws

\*Non-contractual value. Based on 1 measurement each 15 minutes at 25 °C / 77 °F. A correct operation of the device and the storage conditions must be respected.

## Software

**Kilog Lite:** free software to download on [sauermannngroup.com](http://sauermannngroup.com)

Allows the data download (graphics and points statement) and the datalogger configuration.

## Configuration and data processing software

KILOG software allows to configure, save and process your data in a very simple way.

- **Software only:** Ref. KILOG-3-N
- **Complete set:** software + 1 USB cable, Ref. KIC-3-N

## Accessories

Accessories	Reference
1 AA lithium battery	KBL-AA
Safety lock wall mount with padlock	KAV-220
Wired extension for class 220 KISTOCK probes In polyurethane, 5 m / 16' length with male and female mini-DIN connectors Note: several extensions can be wired in order to obtain up to 25 m / 82' cable length	KRB-220
Data collector Collects up to 20,000,000 points from one or several KISTOCK directly on-site. Results restitution on PC of realised datasets	KNT-320
USB micro-USB cable which allows to plug your KISTOCK datalogger to your PC	CK-50



Only the accessories supplied with the device must be used.

## Maintenance

Please avoid any aggressive solvent.

Please protect the device and probes from any cleaning produce containing formalin, that may be used for cleaning rooms and ducts.

## Calibration

A calibration certificate is available as option in paper format. We recommend to carry out a yearly checking.

## Precautions for use

Please always use the device in accordance with its intended use and within parameters described in the technical features in order not to compromise the protection ensured by the device.



BE CAREFUL! Material damages can happen, so please apply the precautionary measures indicated.



Hitma Instrumentatie  
[www.hitma-instrumentatie.nl](http://www.hitma-instrumentatie.nl)  
[info@hitma-instrumentatie.nl](mailto:info@hitma-instrumentatie.nl)  
+31 (0)297 - 514 833

België / Belgique  
[www.hitma-instrumentatie.be](http://www.hitma-instrumentatie.be)  
[info@hitma-instrumentatie.be](mailto:info@hitma-instrumentatie.be)  
+32 (0)2 - 387 28 64

